


METLOGIX SECURITY SETUP

Please follow the steps below to setup and customize the Security Settings within M2 and M3 Software's.

Security Settings Key Items:

1. Lock Calibration settings. (Recommended)
2. Lock Program and Template editing.

Menu Options:

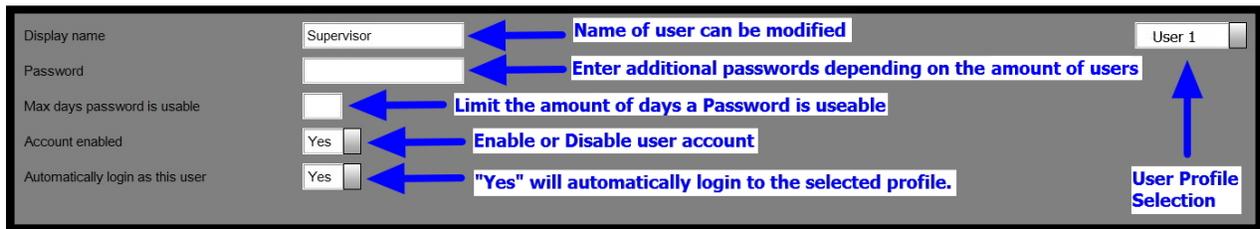

Annotations for the Security Settings form:


- Name of user can be modified**: Points to the "Supervisor" text input field.
- Enter additional passwords depending on the amount of users**: Points to the "Password" text input field.
- Limit the amount of days a Password is useable**: Points to the "Max days password is usable" numeric input field.
- Enable or Disable user account**: Points to the "Account enabled" checkbox.
- "Yes" will automatically login to the selected profile.**: Points to the "Automatically login as this user" checkbox.
- User Profile Selection**: Points to the "User 1" dropdown menu.

In the Measurement screen click on the M2 or M3 icon at the upper Left hand side> Click on Security Settings.

Step 1.

In the Super Admin Profile, enter a password of your choosing.

Select "Automatically login to this user" to No.

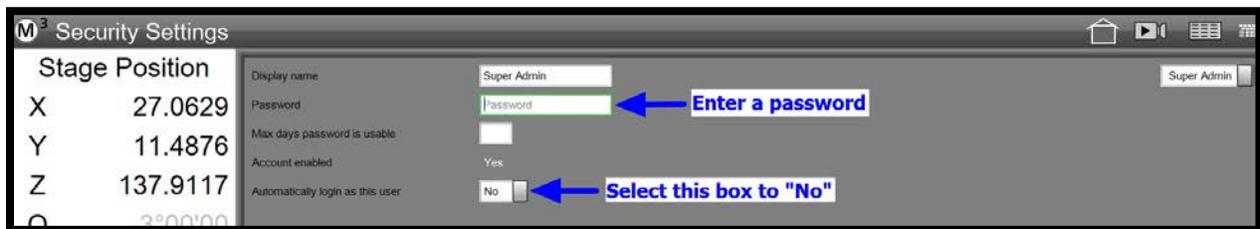

Annotations for the M3 Security Settings form:

- Enter a password**: Points to the "Password" text input field.
- Select this box to "No"**: Points to the "Automatically login as this user" checkbox, which is currently set to "No".

Step 2.

Select which profile you would like to configure. (User 1 Recommended)

Set "Account enabled" and "Automatically login as this user" to Yes.



Annotations for the Security Settings form (User 1):

- Account enabled**: Points to the "Account enabled" checkbox, which is checked.
- Automatically login as this user**: Points to the "Automatically login as this user" checkbox, which is checked.

METLOGIX SECURITY SETUP

Step 3.

The “Access Rights” is located in the lower portion of the of the Security Settings screen. In this area, certain features can be restricted for the specific user.

Access rights for Supervisor, users 1 to 5

Capability	Access
Language Settings	Yes
Axes	Yes
Video Settings	Yes
Part View	Yes
Measure	Yes
Optical Settings	Yes
Optical Edge	Yes

Starrett Recommended Access for Users

Language Settings	YES	Display Formats	YES	NLEC Calibration	NO
Axes	NO	File Locations	YES	Program Settings	YES
Video Settings	NO	Colors	YES	Backup / Restore Settings	YES
Part View	YES	Printouts	YES	Param	NO
Measure	YES	Security Settings	YES	Pixel Resolution Settings	YES
Optical Settings	NO	Sound Settings	YES	Edit Templates	YES
Optical Edge	YES	Error Corrections Settings	NO	Contact Probes	YES
Shape Correction	YES	Squareness	NO	Teach Stitch	YES
Magnifications	NO	NLEC	NO	Edit Locked Programs	YES
Export	YES	SLEC	NO	Profile	YES
Light Control	NO	FOV Cal	NO		

When the Access selections have been chosen, Click Done at and exit to the Measurement screen. Restart the software to confirm the User profile is configured properly.

Additional Options:

Edit Locked Program Set to NO will restrict program editing. When a Program is completed Click the Edit Tab> Program Properties> Set Allow program editing to NO.

Program Properties

Allow program editing No